

1
2
3
4
5
6
7
8
9
10
11
12
13
14
15
16
17
18
19
20
21

FC-R-2016-28

CUMBERLAND FIRE DISTRICT

Resolution

RESOLUTION: Authorize the payment to S&D Road Service in the amount of \$4,145.08.

BE IT RESOLVED BY THE CFD COMMITTEE AS FOLLOWS:

WHEREAS: Engine 3 needed operational required repairs.


WHEREAS: S&D Road Service is a recognized repair vendor of CFD

WHEREAS: All work was completed as charged to acceptable standards

NOW, THEREFORE, BE IT RESOLVED BY THE CUMBERLAND FIRE DISTRICT AS FOLLOWS:

RESOLVED: This authorizes the payment of \$4,145.08 out of account 1008

Approved this 8th day of June, 2016

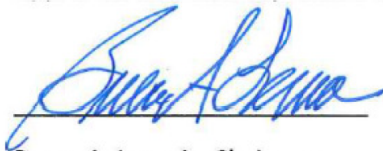

Bruce A. Lemois, Chairman



Debra Auclair, Clerk

YAY: NAY
 7 0

RECEIVED MAY 3 1 2016

S&D Road Service, Inc

9 Whipple Street Unit 4

Cumberland, RI. 02864

Phone: 401-312-0017 Fax: 401-312-2012

"We Take Personal Care of Our Customers"

Work Completed Date : 05/25/2016

Vehicle Received: **05/25/2016**

INVOICE

13010

Org. Est. # 019030
RI Insp. Station 118-C
Federal Inspection

INVOICE

Invoice Date: **05/25/2016**

Cumberland Fire Dept.

3502 Mendon Rd

Cumberland, RI 02864

Home : 401-658-0544

Cust ID : 836

2005 Pierce - Fire Truck -

Lic # : 2341 FIRE - RI

Unit # : E43

VIN # : 4P1CD01S1 5A005492

Odometer In : 84236

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
Power Steering Fluid (Quart) Dexron	8.00	4.12	32.96	*** CUSTOMER WANTS TO CHECK POWER STEERING LEAK AND LEAK ON PISTON FOR CAB ***	800.00
Hydraulic Lift Cylinder 1279008	1.00	580.04	580.04	1. PISTON TO LEFT CAB WAS LEAKING FROM ROD SEAL 2. REMOVED PISTON AND FOUND THAT PISTON ASSY. HAS BEEN REPAIR A FEW TIMES 3. REMOVED BRACKET OFF OLD PISTON AND INSTALLED A NEW PISTON AND RE INSTALLED BRACKET 4. CHECKED FOR POWER STEERING LEAK AND FOUND OIL LEAKING FROM POWER STEERING BOX 5. REMOVED POWER STEERING BOX, AND REMOVED PITMAN ARM, REMOVED COVER TO INSTALL NEW SEAL AND FOUND SHAFT WAS DAMAGED, BUTTING A NEW SEAL WOULD HAVE STILL LEAK FLUID 6. ORDERED A REMAN POWER STEERING BOX, AND INSTALLED (POWER STEERING BOX HAS SAME WARRANTY BUT HALF THE PRICE THAN FROM DEALER) 7. REPLACED STEER BAR AND TIE ROD END THAT HAD PLAY IN FRONT END	
Stay arm Spring 42-7875	1.00	21.16	21.16	FRIGHT	16.00
Fiber Washer 82-3067-0001	2.00	0.77	1.54	PERFORM FOUR WHEEL ALIGNMENT ON UNIT	275.00
Steering Box Assembly ST3 M110PGX1	1.00	1607.06	1607.06	ROAD TESTED UNIT FOR ALIGNMENT PURPOSE. CHECK TIRE PRESSURE AIR UP TO REQUIRED PSI.	
LUG NUT 33mm	1.00	11.45	11.45	Hazardous Materials	8.99
TIE ROD END 3303274	2.00	237.23	474.46		
LINK 3582900	1.00	307.43	307.43		
Shop Supplies			8.99		

Cumberland Fire District

Approved by _____

Date _____

Station # _____

Vehicle # _____

GL Acct # _____

Org. Estimate 4,070.98 Revisions 0.00 Current Estimate 4,070.98

Labor:	1,075.00
Parts:	3,045.09
Sublet:	16.00
SubTotal:	4,136.09
HazMat:	8.99
Tax:	0.00
Total:	4,145.08
Bal Due:	\$4,145.08

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. WARNINGS If wheels are taken off, customer is responsible to retighten lug nuts after 100 miles. Return after 200 miles so we may check U-Bolt nuts.

Signature _____ Date _____ Time _____