

1
2
3
4
5
6
7
8

FC-R-2017-19
CUMBERLAND FIRE DISTRICT
Resolution

9
10
11

RESOLUTION: Authorizing the Finance Director to pay Ralco Equipment Company, Inc. an amount not to exceed \$2,943.27.

12
13

WHEREAS: Ralco Equipment Company, Inc. was contracted to make repairs to Truck 5.

14
15

WHEREAS: All repairs have been made with the approval of the Chief.

16
17

NOW, THEREFORE, BE IT RESOLVED BY THE CUMBERLAND FIRE DISTRICT AS FOLLOWS:


18
19
20

RESOLVED: The Finance Director is authorized to pay Ralco Equipment Company, Inc. an amount not to exceed \$2,943.27.

21
22

Voted on this 27th day of June, 2017

23
24
25
26

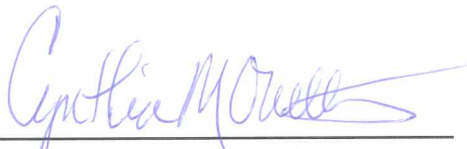

Cynthia Ouellette, Chairperson

27
28
29

PASSED:
YAY: 6 NAY: 0

Ralco Equipment Company, Inc
 51 Ralco Way/PO Box 35
 Cumberland, Rhode Island. 02864-0035
 Phone: 401-726-3095 Fax: 401-726-6950
 We do the job once and we do it right!

9268
 Org. Est. # 015929
 RI Inspect Station 155C
 ralcotruck45@verizon.net

INVOICE

Print Date : 06/15/2017

Cumberland Fire Department - Chief Finlay
 3502 Mendon Road
 Cumberland, RI 02864
 Office 401-658-0544 --- Cellular 401-474-0314 Fin
 Cust ID : 934

1994 E-One - Single Axle Ladder Truck
 Cummins
 Lic # : 705 - RI Odometer In : 89,486
 Unit # : T5 Odometer Out :
 VIN # : 4ENRAAAA4P1002952

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
Seal Ring	1.00	10.76	10.76	Perform major preventative maintenance special.	0.00
2005139				Change engine oil, oil filter(s), fuel filter(s). Check all engine fluid levels and add to fill. Check all gear case fluid levels. Check front end and all steering linkage. Check exhaust system. Check drive line and all u-joints. Check springs, air bags, and all suspension components. Check brake system and adjust. Check all exterior lights, lenses, and reflectors. Check function of over head cargo box door if equipped. Check battery condition and charging system. Lubricate complete unit. Perform complete service inspection.	
FUEL FILTER	1.00	26.94	26.94		
BF788					
FUEL FILTER	1.00	31.74	31.74		
BF1280					
Power Lube	1.00	7.53	7.53		
05006					
OIL FILTER	1.00	63.53	63.53	ADD: Replace two missing valve stem caps, needle valves. ADD: Replace one marker lamp, right rear. Repair wiring and secure with new retainers.	
LF3000					
ENGINE OIL	32.00	6.91	221.12	ADD: Top off power steering, transmission fluids.	
15W40				Air leak.	0.00
AUTO. TRANS. FLUID	3.00	8.61	25.83	Run unit and found major air leak coming from air compressor feed line to air dryer. Heavy stainless braided line worn a hole on radiator support. Remove interior of cab to expose engine cover for access. Remove line assy. Remove discharge port adapter and replace with updated unit. Remove and replace fittings on compressor and air dryer to accommodate newer style line. Install new stainless steel braided line and route in manner to avoid rubbing and premature failure. Install necessary insulated clamps, supports and retainers to secure line. Run unit and verify operation. Check for leaks, none found.	
33123					
Power Steering Fluid	2.00	7.39	14.78	Found secondary air leak at air seat, driver position. Cut out bad section of line and install new section of line and union. Check operation and for leaks.	
4611					
EX Life Coolant	3.75	8.74	32.78	Remove on spot chain units.	0.00
AF3000					
COOLANT FILTER	1.00	30.92	30.92	On spot chains units left side missing and bracket rubbing tire. Right side broken and being held up with bunji cord. Contact chief and recommend removal until new units come in. Disconnect air lines and plug. Secure out of the way. Heat and remove all retainers and remove on spot units, brackets and arms as needed.	
WF2071					
Brake Clean	2.00	6.32	12.64	Secure front bumper.	0.00
C32					
FLUIDS/GREASE	1.00	29.95	29.95	Driver side of bumper loose and falling off. Attempt to tighten original hardware however rotted and spinning. Drill two new holes per side in front of bumper. Cut and fit two steel plates on interior of unit to reinforce. Install stainless though bolt hardware on left and right sides. Secure and torque. Verify bumper now tight and not rattling or moving while operating.	
CITMISC					
Needle Insert Valve	2.00	2.93	5.86	Labor Charge	1,920.75
1503SS29					
SS Seal Cap	2.00	2.51	5.02	Perform necessary state inspection on unit.	15.00
1800SS6					
Marker Lamp	1.00	8.83	8.83	Perform inspection and install sticker on unit.	
26301R				Sticker: R-20948	
SS ST Screw	2.00	0.67	1.34	Environmental Fee	15.95
20063					
ELECTRICAL CONNECTOR	3.00	2.80	8.40		
B8CHS					
ELECTRIAL WIRE	4.00	1.39	5.56		
12GA100BN					

Ralco Equipment Company, Inc
 51 Ralco Way/PO Box 35
 Cumberland, Rhode Island. 02864-0035
 Phone: 401-726-3095 Fax: 401-726-6950
 We do the job once and we do it right!

9268
 Org Est. # 015929
 RI Inspect Station 155C
 ralcotruck45@verizon.net

INVOICE

Print Date : 06/15/2017

Cumberland Fire Department - Chief Finlay
 3502 Mendon Road
 Cumberland, RI 02864
 Office 401-658-0544 --- Cellular 401-474-0314 Fin
 Cust ID : 934

1994 E-One - Single Axle Ladder Truck
 Cummins
 Lic # : 705 - RI Odometer In : 89,486
 Unit # : T5 Odometer Out :
 VIN # : 4ENRAAA4P1002952

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
Heat Shrink 91662	4.00	2.13	8.52		
PROTECTIVE SPLIT LOOM 5-025	6.00	0.79	4.74		
Corrosive Cmpd 97944	0.50	4.99	2.50		
Discharge Port Bracket 62067	1.00	22.73	22.73		
Flange Gasket 19256	1.00	3.87	3.87		
Hex Head Cap Screw Kit 8B516X125CK	2.00	1.47	2.94		
Ultra Copper Silicone 81878	1.00	4.96	4.96		
HD Metal 90 deg Flare Fitting 759010FL	1.00	19.71	19.71		
SS Discharge Line Assy 89629SS	1.00	98.79	98.79		
VINYL INSUL CLAMP 29783	4.00	3.94	15.76		
Retainer Bolt Kit 8B38X100CK	4.00	1.82	7.28		
HD Metal 90 Deg Flare Fitting 509010FL	1.00	18.55	18.55		
Teflon Tape 06195	1.00	2.79	2.79		
Nylon Tubing 2500NT	2.00	3.34	6.68		
Brass ST Comp Fitting 18MPX25COP	1.00	7.13	7.13		
Full Comp Union 25CUX25CMP	1.00	11.42	11.42		
Cut Off Wheel 01989	1.00	11.93	11.93		
Brass Comp Fitting 25MPX38COP	2.00	9.17	18.34		

Ralco Equipment Company, Inc
 51 Ralco Way/PO Box 35
 Cumberland, Rhode Island 02864-0035
 Phone: 401-726-3095 Fax: 401-726-6950
 We do the job once and we do it right!

9268
 Org. Est. # 015929
 RI Inspect Station 155C
 ralcotruck45@verizon.net

INVOICE

Print Date : 06/15/2017

Cumberland Fire Department - Chief Finlay
 3502 Mendon Road
 Cumberland, RI 02864
 Office 401-658-0544 --- Cellular 401-474-0314 Fin
 Cust ID : 934

1994 E-One - Single Axle Ladder Truck
 Cummins
 Lic # : 705 - RI Odometer In : 89,486
 Unit # : T5 Odometer Out :
 VIN # : 4ENRAAA4P1002952

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
Brass Hx Pipe Coupler 25H25PC	2.00	5.23	10.46		
Allen Head Pipe Plug 25AUPP	2.00	3.16	6.32		
Support Clamp 20567	4.00	5.59	22.36		
Steel Reinforcement Plate 254080SP	2.00	16.78	33.56		
SS Hx Head Cap Screw Kit 5B50X150SCK	4.00	7.97	31.88		
Shop Supplies			9.95		
				**** Recommendations **** Steer axle shocks leaking and blown. Rear brake air valve loose and dangling. Needs replacement. Rear frame and support cross member rotted away and broken on right rear in line with rear spring hangers. Pto seems to have minor leak. Need to steam clean to confirm. Exhaust system will need replacement at next inspection period.	
[Technicians : Vecchio, JR, Theodore 20; Vecchio, Joseph 21]					

Org. Estimate	\$ 2,943.27	Revisions	\$ 0.00	Current Estimate	\$ 2,943.27	Additional Cost	Revised Estimate	Labor:	1,935.75
								Parts:	926.70
								Sub:	2,862.45
								Tax:	64.87
								HazMat:	15.95
								Total:	\$2,943.27
								Bal Due:	\$2,943.27

[Payments -]

I hereby authorize the above repair work to be performed. I hereby grant you or your employees permission to operate the car or truck herein described on street, highways, etc for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. All sums shall become due and payable upon completion. All legal, attorney, and/or collection fees pursuant to this contract shall be paid to Ralco Equip Co by the undersigned

Signature.....

Date..... Time.....