1		FC-R-2019-10							
2	CUMBERLAND FIRE DISTRICT								
3		Resolution							
4	DECOLUTION								
5	RESOLUTION:	Authorizing the Business Manager to pay Ralco Equipment Company, Inc., an amount not to exceed \$4,574.08.							
6 7		Company, Inc., an amount not to exceed \$4,574.08.							
8	WHEREAS:	Ralco Equipment Company, Inc., has made repairs to Engine 3.							
9									
10	WHEREAS:	All repairs have been made with the approval of the Chief.							
11									
12	NOW, THEREFORE, BE IT RESOLVED BY THE CUMBERLAND FIRE DISTRICT AS								
13		FOLLOWS:							
14	DECOLVED.	The Desire of Manager is not be in the control of the Desire of the Control of th							
15 16	RESOLVED:	The Business Manager is authorized to pay Ralcoa Equipment Company, Inc., an amount not to exceed \$4,574.08.							
17		company, inc., an amount not to exceed \$4,374.08.							
18									
19									
20	Voted on this 2	26th day of March 2019							
21									
22									
23		Conthin M. Rulett							
24		- Cyrof roaci C O coole							
25 26		Cynthia Ouellette, Chairperson							
26	PASSED:								
28		AY:							

Ralco Equipment Company, Inc

51 Ralco Way/PO Box 35

Cumberland, Rhode Island. 02864-0035 Phone: 401-726-3095 Fax: 401-726-6950

We do the job once and we do it right!

INVOICE

9976

Org. Est. # 016745 RI Inspect Station 155C ralcotruck45@gmail.com

INVOICE

Date: 03/05/2019 2006 Pierce - Dash Fire Engine - Detroit **Cumberland Fire Department - Chief Finlay**

3502 Mendon Road

Cumberland, RI 02864

Office 401-658-0544 -- Cellular 401-474-0314 Fin

Lic #: 2341

Unit#:E3

VIN #: 4P1CD01S1 **5A005492**

Engine Hrs In: 9195.0

Engine Hours Out: 0.0

Odometer In: 95641

Part Description / Number	Qty	Sale	Ext	Labor Description Ext
Cut Off Wheel	1.00	11.93	11.93	Air leak in rear. n/c
01989				Jack up rear axle and support. Inspect rear brakes, cans, liens and related. Found ABS modulator valve on left side leaking air
Roloc Disc	1.00	9.81	9.81	excessive when brakes applied. Found rear brakes excessively out
01408				of adjustment due to slack adjusters not holding and brake
Steel Reinf Plate	2.00	8.97	17.94	chambers releasing slowly. Contact chief and video all findings. Recommend replacement of rear brake chambers, slack adjusters,
2530060	0.00	0.00	42.00	removal of rear wheels for brake inspection and both left and right
Cap Screw Kit	6.00	2.28	13.68	ABS valves. Repairs were approved.
8B38X175CK	4.00	1.28	5.12	Remove and replace ABS modulator valves with new n/c updated units.
Welding Rod 6011	4.00	1.20	0.12	Disconnect electrical harness and retainers. Remove air lines and
Cap Screw Kit	4.00	1.79	7.16	fittings to unit. Remove remains of rotted and corroded hardware.
8B38X125CK	1.00	*****		Remove valves. Locate new update replacement valves. Install on brackets and secure with new retainers. Transfer fittings and
ABS Modulator Valve Assy	2.00	323.48	646.96	replace as needed. Reconnect air lines. Install adapter harness for
R950127				update valve and plug into system. Insulate and secure all connections.
Adapter Harness	2.00	50.11	100.22	
610449H				chambers. Remove wheels for brake inspection and to
Cap Screw Kit	4.00	3.26	13.04	press off slack adjusters. Remove wheels and tires as needed. Back off brakes and remove
8B516X425CK				brake drums. Remove brake shoes, hardware and spring retainers.
HD Brs 90 Deg Street Elbow	2.00	7.33	14.66	Remove air lines to each brake chamber. Cut push rod and remove
38MP90SE				chamber hardware. Remove chambers. Remove slack adjuster retainer snap rings and washers. Press slack adjuster off from
HD Brs 45 Comp Fitting	2.00	9.27	18.54	s-cam using necessary tooling and access with brakes removed.
38MP4538CMP	0.00	2.00	40.00	Clean all areas and dress s-cam shafts. Install new self adjusting
Nylon Air Tubing 3800NT	6.00	3.06	18.36	slack adjusters. Shim with necessary shim kits and secure with new retainer rings. Install new 36-30 HD brake chambers upgrading from
Full Comp Union	2.00	10.71	21.42	30-30 style. Cut push rod to length and install new jam nut, yoke
3838FCMP	2.00	10.71	21.72	and retainers. Install and secure with new hardware. Transfer fittings for air lines. Reconnect air lines and replace one as needed.
PROTECTIVE SPLIT LOOM	9.00	1.35	12.15	Install new clevis and retainer pins. Lubricate all areas. Clean and
5-029	0.00	,.00		inspect brake shoes and hardware. Found lining chipped and worn
VINYL INSUL CLAMP	2.00	3.89	7.78	on inner edge with approx 50% life left. Contact chief and he came down to view. Due to the nature of the unit being a spare it was
3875IC				decided to re install these shoes and dress up as life left in all four.
Di Electric Cmpd	1.00	6.47	6.47	Clean and dress all shoe edges. Install shoes and lubricate all areas. Replace spring hardware where needed. Install brake
DL4				drums, wheels and tires. Lubricate and threads and torque
Auto Slack Adjuster	1.00	135.59	135.59	retainers. Adjust all brakes. Run unit and verify proper brake
R803056				chamber operation, adjustment, and release. After all repairs complete, road test unit and verify repairs and heat temps.
Auto Slack Adjuster	1.00	135.59	135.59	Parking brake indicator in cab stay on all the time with n/c
R803057				parking brake on or off.
Snap Ring Shim Kit	2.00	6.76	13.52	
K629063			,	
Surf Cond Disc	2.00	6.97	13.94	
7485		000.01	F70.00	
30-36 HD Upgrade Brake Chamber	2.00	289.94	579.88	
Visit us on the web: www.ralcoequip	oment.com			Our Email Address: ralcotruck45@gmail.com

Ralco Equipment Company, Inc

51 Ralco Way/PO Box 35

Cumberland, Rhode Island. 02864-0035 Phone: 401-726-3095 Fax: 401-726-6950

We do the job once and we do it right!

INVOICE

9976

Org. Est. # 016745 RI Inspect Station 155C ralcotruck45@gmail.com

Odometer In: 95641

Date: 03/05/2019

INVOICE

Cumberland Fire Department - Chief Finlay

3502 Mendon Road

Cumberland, RI 02864

Office 401-658-0544 -- Cellular 401-474-0314 Fin

2006 Pierce - Dash Fire Engine - Detroit

Lic#: 2341

Unit#:E3

VIN #: 4P1CD01S1 **5A005492**

Engine Hrs In: 9195.0

Engine Hours Out: 0.0

Part Description / Number	Qty	Sale	Ext	Labor Description Ext			
MA3036SD WASHER 8FW58F	4.00	2.91	11.64	Inspect and trace air liens to rear valve and indicator air switch. Disconnect terminals and remove switch. Test and found unit in need of replacement. Install new updated switch and bushing. Secure and seal. Install new eyelet terminals and secure wire			
LOCK NUT 8SLN58C	4.00	3.87	15.48	harness to new switch. Insulate and secure all connections and cover with silicone sealer for extended life. Air up system and ver operation of parking brake indicator on and off with brake released			
Jam Nut 61077	2.00	2,41	4.82	and or applied.			
HD Forged Steel Yoke w/ Pin Kit R810019	2.00	49.94	99.88	Disassemble dash and found parking brake valve leaking from center shaft. Remove retainers and yellow handle assembly.			
GRS Fitting 226-483	2.00	3.29	6.58	compression fittings and 90 deg elbows for clearance. Seal and			
GRS Fitting 90 229-501	2.00	4.01	8.02				
Rubber Flex Air Line 16318	1.00	17.43	17.43	Perform Cumberland Fire chassis lubrication per n/c maintenance agreement.			
Rubber Flex Air Line 16324	1.00	21.02	21.02	Jack up and support all axles during the course of the repairs. CHeck all chassis components and perform complete chassis lubrication during repairs.			
45 Deg Street Elbow 38MP45SE	2.00	8.36	16.72	NOTE: Rear spring pins hard taking grease, some will some will not. Remove fittings and spray penetrating lube on all areas to aid in			
Air Hose Holder/Divider 11549	2.00	9.76	19.52	Labor Charge 2,142.38			
Roloc Disc 01406	2.00	11.73	23.46	Discount from shop labor rate of 108.50/hour to \$98.50/hour per usual for CFD. Repairs completed on Saturday at no additional charge.			
Brakeclean C32	2.00	6.32	12.64				
Brake Spring HDW Kit KIT9081HD	2.00	29.32	58.64				
Syn Slide Lube BK4	2.00	6.69	13.38				
Anti Seize 80078	1.00	9.36	9.36				
Lithoplex Press Lube PS24968	2.00	9.73	19.46				
Teflon Tape <i>06195</i>	1.00	5.58	5.58				
Lectra Motive Cleaner 05018	1.00	7.58	7.58				
HD Air Switch (Parking Brake) BE13240	1.00	57.91	57.91				
Brass Reducer 25FMPX38MPT	2.00	4.96	9.92				
Visit us on the web: www.rald	coequipment.com			Our Email Address: ralcotruck45@gmail.com			

Ralco Equipment Company, Inc

51 Ralco Way/PO Box 35

Cumberland, Rhode Island. 02864-0035 Phone: 401-726-3095 Fax: 401-726-6950 We do the job once and we do it right!

INVOICE

9976

Org. Est. # 016745 RI Inspect Station 155C ralcotruck45@gmail.com

Date: 03/05/2019

INVOICE

Cumberland Fire Department - Chief Finlay

3502 Mendon Road

Cumberland, RI 02864

Office 401-658-0544 -- Cellular 401-474-0314 Fin

2006 Pierce - Dash Fire Engine - Detroit

Lic#: 2341

Unit#:E3

VIN #: 4P1CD01S1 5A005492

Engine Hrs In; 9195.0

Engine Hours Out: 0.0

Odometer In: 95641

				Engine Hrs in , 9195.0	Engine Hours Out . 0.0
Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
Ring Terminal RT8	2.00	2.92	5.84		
Heat Shrink 91662	4.00	2.13	8.52		
Clear Sealer 80050	1.00	8.92	8.92	1	
SS Terminal Nut 5HN1032SS	4.00	0.97	3.88		
Air Control PP1 Valve (Dash) 284726	1.00	97.47	97.47		
BRS 90 Deg Street Elbow . 18MP90E	2.00	5.88	11.76		
Brs Comp Fitting 18MPST38CMP	2.00	8.53	17.06		
Jam Support Nut 156278	1.00	9.55	9.55	i	
Shop Supplies			9.95		
			11.1		
·					

Org. Estimate 4,574.08 Revisions 0.00 Current Estimate 4,574.08

2,142.38 Labor: Parts: 2,415.75

HazMat:

15.95

SubTotal: Tax:

4,574.08 0.00

Total: Bal Due:

4,574.08 \$4,574.08

Customer Number: 934

Vehicle Received: 3/5/2019

Thereby authorize the above repair work to be performed. Thereby grant you or your employees permission to operate the car or truck herein described on street, highways, etc for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. All sums shall become due and payable upon completion. All legal, attorney, and/or collection fees pursuant to this contract shall be paid to Ralco Equip Co by the undersigned

Page 3 of 3

Signature_ Visit us on the web:

[Payments -]

Date

www.ralcoequipment.com